

Viking Subscriber Software 25.2 Point Release 1

Release Date: November 20, 2025

Title: FSN-1125-VIKING-42

Overview

This Field Software Notice (FSN) announces the KENWOOD Viking® Subscriber Software Version 25.2 Point Release 1.

IMPORTANT: We recommend all Armada Server users update to version 1.46.14 (this release).

Software Versions

The following table lists the Viking Software items, and corresponding versions included in the 25.2 Point Release 1.

Item	Version
Armada Client	1.46.14
Armada Server	1.46.14
Armada Server Demo	1.46.14
VP8000 Firmware Image	8.46.15
VP5000/6000 Firmware Image	8.46.15
VM8000 Firmware Image	8.46.15
VM5000/6000/7000 Firmware Image	8.46.15

Issues Addressed

The following table lists the customer-impacting issues resolved in the 25.2 Point Release 1.

Issue	Overview
Armada Crash with Many Multi-Deck Radios	An issue has been resolved where Armada crashed when scanning a database containing many Multi-Deck radios.
Unable to load Hardware ARC4 keys without SCM	An issue with loading Hardware ARC4 keys without the SCM has been resolved.
Repeater TA Incorrectly Uses the Tx RAN	An issue with the Radio in repeater TA mode incorrectly using Tx RAN has been resolved.
VM8K Keyloader Detach Crash	An issue with VM8000 crashing when the keyloader cable is disconnected has been resolved.
Invalid Key display in DMR/NXDN Scan	An issue with invalid key displaying in both NXDN and DMR during Scan/Radio Wide Scan has been resolved. The invalid key display was related to a default Key ID Restriction in DMR/NXDN scan.
Customer DMR Site Roaming Scan List Corruption	An issue with Customer DMR Site Roaming Scan List corruption after moving around channels has been resolved.
KCH19/21 No Volume Control in Keypad Lockout	Volume can be adjusted now in keypad lockout. Two new check boxes have been added to override the keypad lockout settings.
VP5430 and VM5930 Replacement Parts	Armada will restrict firmware downgrades for new VP5430 Portables, and VM5930 Mobiles due to software changes to support a part supply change. Radios manufactured after November 2025 will be restricted to 8.46.15 or newer.

For questions regarding this FSN, please contact the KENWOOD Viking team at <https://lmsupport.kenwood.com>

EF Johnson Technologies, Inc. | a JVCKENWOOD Company
 1440 Corporate Drive, Irving, TX 75038