

TP304740 PRINT HAMMER ASSEMBLY

APPARATUS AFFECTED: All 28- and 35-Type Typing Units.

OBJECT: To prevent breakage of the TP112633 print hammer springs.

CHANGE: The old style TP150061 print hammer, TP112633 print hammer spring and TP93729 wick are to be replaced by a new style TP304740 print hammer assembly. The assembly consists of a TP304362 hammer, a TP304363 spring and a TP131318 wick but these parts are not available as components.

For location of parts, see Bulletin 1149B, page 3-41, change 9, and Bulletin 1187B, page 4-27.

IDENTIFICATION: The old style spring hooks into a spring eye on the print hammer. The new style spring is screwed on a threaded stud on the print hammer.

INTERCHANGEABILITY: New and old style parts are not individually interchangeable but are interchangeable as assemblies.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change shall be made as soon as manufacturing conditions permit. This is expected to be about 1/1/65.

W.E.CO. STOCK OF OLD STYLE PARTS: Should not be used after new style print hammer assemblies are available from Teletype.

APPLICATION TO APPARATUS IN THE FIELD: Where desired, the new style assemblies may be incorporated.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: All units shall be equipped with new style print hammer assemblies as soon as the assemblies are available from Teletype.