

TP182698 CABLE ASSEMBLY (DC CARD DIALER)

APPARATUS AFFECTED: 33A-4, 33C-4, 33D-4, 33F-4 Teletypewriter-Sets; 35A-4 Call Control Unit; TP182698 Cable Assembly.

OBJECT: To prevent dialing errors when operating the card dialer by electrically shunting the rotary dial pulsing contacts.

CHANGE: 1. The TP182698 cable assembly is modified by adding a blue wire from A-1 to B-1. The added blue wire is crimped in a common terminal with the existing blue wire at A-1.

2. The blue wire on terminal 15 ("TS3" for 33 apparatus and "H" for 35 apparatus) is moved to terminal 8.

The TP182698 cable assembly is listed as part of the TP182487 modification kit (non-Bell) in Section 574-100-800, issue 1, page 2.

Note: Figure 1 in Specification 50,164S, issue 4, covering the above modification kit, illustrates the wiring as changed by modifying the TP182698 cable assembly.

IDENTIFICATION: See "CHANGE".

INTERCHANGEABILITY: New style cable assemblies are interchangeable with old style cable assemblies.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change is now in effect.

W.E.CO. STOCK OF OLD STYLE PARTS: Should not be furnished after new style cables become available. Old style cable assemblies may be modified as indicated under "CHANGE".

APPLICATION TO APPARATUS IN THE FIELD: Where desired, the new style cable may be incorporated or wiring modified as indicated under "CHANGE".

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: All units shall be equipped with new style cable assemblies or modified old style cable assemblies.