



# Hamilton Beach 70730 Drive Shaft Replacement

Replace the drive shaft of your Hamilton Beach 70730 food processor.

Written By: Mack Bernard



---

## INTRODUCTION

The drive shaft is essential and may possibly have a stripped gear, causing the blade not to turn. There are several steps in order to take this out and replace it. Beware of lubricant along the bottom of it.

---

### TOOLS:


- [64 Bit Driver Kit](#) (1)
  - [Metal Spudger](#) (1)
-

## Step 1 — Bowl



- Remove the cover by turning it in the counterclockwise direction.

## Step 2

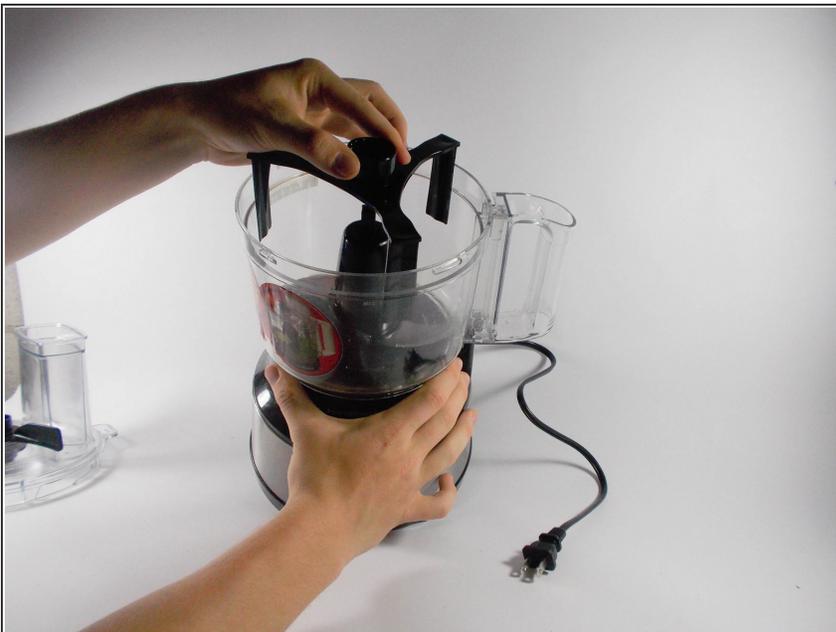

- Remove the bowl scraping mechanism by simply grabbing the middle section and lifting.

### Step 3



- Remove the blade mechanism by lifting it off of the blade shaft.

### Step 4



- Place hands on bowl and turn it gently, but firmly, counter-clockwise.

## Step 5



- i** Make sure there is no food or grime along the outside sides of the bowl or the base.

## Step 6 — Drive Shaft



- Using the metal spudger, remove the four adhesive plastic covers that hide the screws.
- i** These covers are adhered to the screws.

## Step 7



- Remove any access glue that is adhered to the screws with the precision tweezers.

## Step 8



- Using a JIS #1 driver, remove the four 10 mm screws.

## Step 9



- Lift the drive shaft.

To reassemble your device, follow these instructions in reverse order.