

Classification: A1C

Billable to Telco: Yes X No

APPARATUS AFFECTED: All 33 Call Control Units except UCC21 and UCC22.

All 35 Call Control Units.

35G, 35H, 35M, 35N, 35P, 35R, 35AA, 35AH and 35AL Electrical Service Units.

35AT, 35AU, 35AW, 35BC, 35BD, 35BE, 35BF, 35BG, 35BH, 35BP and 35BR Teletypewriter-Sets (Electrical Service Unit).

TP197041, TP199360, TP301651, TP304922, TP311076, TP319257, TP320255 and TP328098 Power Distribution Assemblies.

PART AFFECTED: TP178831 Receptacle Connector
TP178832 Adapter Plate
TP181240 Screw W/Lockwasher
TP182710 Upper Bracket
TP186426 Bracket
TP186628 Upper Bracket
TP197078 Mounting Plate
TP319258 Mounting Plate

REASON: (1) To conform to latest Underwriters Laboratories requirements.

(2) To provide a legible warning label (100 W. MAX) near the receptacle connector.
(See SUPPLEMENTAL INFORMATION (1).)

CHANGE: (1) All 35 Call Control Units

(1A) The TP178831 receptacle connector and TP178832 adapter plate are replaced by a new TP301713 receptacle connector. The TP182710 upper bracket is replaced by the new TP186628 upper bracket. The two TP181240 screws w/lockwashers which mount the above receptacle connector and adapter plate to the old TP182710 upper bracket are removed.

See Attachment Sheets 1 and 2 for an illustration of old and new parts.

(1B) A No. 6 Ring Terminal is added to the ground lead of the call control cables (the TP193470, TP193473, TP301758 and TP305410 cable assemblies) in order to accept the screw which is used on the ground terminal of the TP301713 receptacle connector.

The changes in CHANGE (1A) and (1B) are reflected on the following wiring diagrams (part of WDP0044, WDP0072, WDP0172, WDP0173, WDP0241 and WDP0295):

5824WD, Issue Control Sheet, Issue 9, Actual Wiring Diagram for 35A Call Control Unit (LCCU300).

5824WD, Issue 21, Sheet 2, Actual Wiring Diagram for 35A Call Control Unit (LCCU300).

5825WD, Issue 12, Sheet 1, Actual Wiring Diagram for 35B Call Control Unit (LCCU301).

5825WD, Issue 13, Sheet 2, Actual Wiring Diagram for 35B Call Control Unit (LCCU301).

6000WD-C3, Issue 18, Apparatus Figure for Teletypewriter-Sets (ASR).

6020WD-C2, Issue 7, Apparatus Figure for 35A, 35B, 35C, 35D, 35A-X3, 35B-X3, 35C-X3 and 35D-X3 Teletypewriter-Sets (KSR).

6040WD-C2, Issue 8, Apparatus Figure for 35E, 35F, 35G, 35H Teletypewriter-Sets (RO).

CHANGE: (continued)

6524WD, Issue Control Sheet, Issue 14, Actual Wiring Diagram for Call Control Unit.

6524WD, Issue 14, Sheet 2, Actual Wiring Diagram for Call Control Unit (LCCU302).

7245WD, Issue 9, Sheet 2, Actual Wiring Diagram for (LCCU303) 35C Call Control Unit for use with the 35BJ Set. (KSR)

(2) All Units and Assemblies listed in APPARATUS AFFECTED

The TP186426 and TP186628 brackets and the TP197078 and TP319258 mounting plates (part of the above mentioned units and assemblies) are changed by replacing the steel stamped warning (100WATTS MAX) with a TP343470 label (100 W. MAX) to be affixed near the receptacle connector.

PUBLICATION AFFECTED: Section 574-201-400, Issue 3.
Section 574-202-400, Issue 3.
Section 574-227-400, Issue 3.
Section 574-227-800, Issue 2, Page 4.
See SUPPLEMENTAL INFORMATION (2).

IDENTIFICATION: (1) See Attachment Sheets 1 and 2.
(2) The new TP343470 label (100 W. MAX) has red letters on a white background.

INTERCHANGEABILITY: Old and new parts are interchangeable as sets. The TP178831 receptacle connector and TP178832 adapter plate must be used with a TP182710 upper bracket. The new TP301713 receptacle connector must be used with the TP186628 upper bracket.

PARTS AVAILABILITY: All new parts are available.

SUPPLEMENTAL INFORMATION: (1) A1C - Same as A1 except A1 applies only to CHANGE (2) and TELCO need only affix labels when making routine service calls. CHANGE (1) is classified D.

(2) The TP186426 and TP186628 brackets are illustrated in Section 574-123-800, Issue 4, Pages 3 and 5.





The TP197078 and TP319258 mounting plates and the TP197041, TP199360, TP301651, TP304922, TP311076, TP319257, TP320255 and TP328098 power distribution assemblies are illustrated in the following:

Section 574-226-800, Issue 3, Pages 6, 7, 8 and 13.
Section 574-226-801, Issue 2, Pages 6, 7 and 8.
Section 574-226-802, Issue 2, Page 6.

REFERENCES: None

TCN INDEX CLASSIFICATION: 33 AD 02, 35 AD 01, 35 AE 05



Attached Sheets 1 and 2

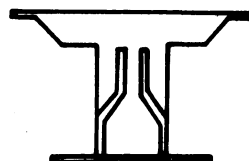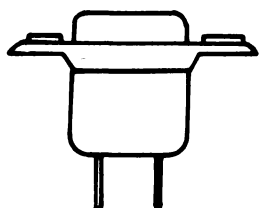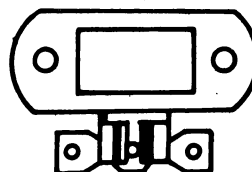

OLD


**TP178831 TWO POINT
RECEPTACLE CONNECTOR**

**TP178832
ADAPTER PLATE**

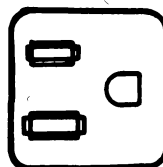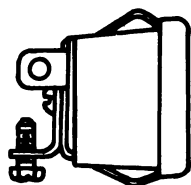


NEW

TP301713 RECEPTACLE CONNECTOR

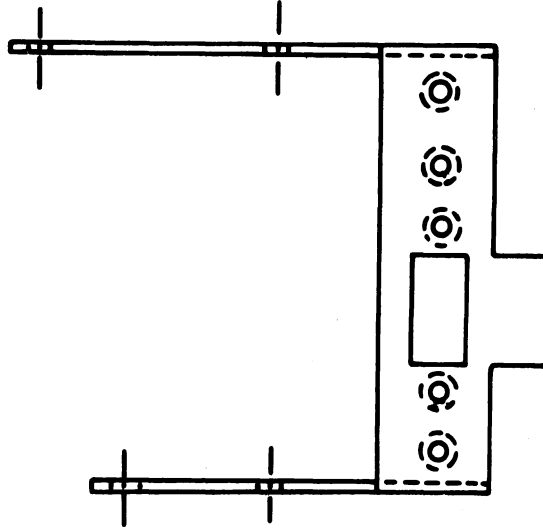

OLD TP182710 UPPER BRACKET

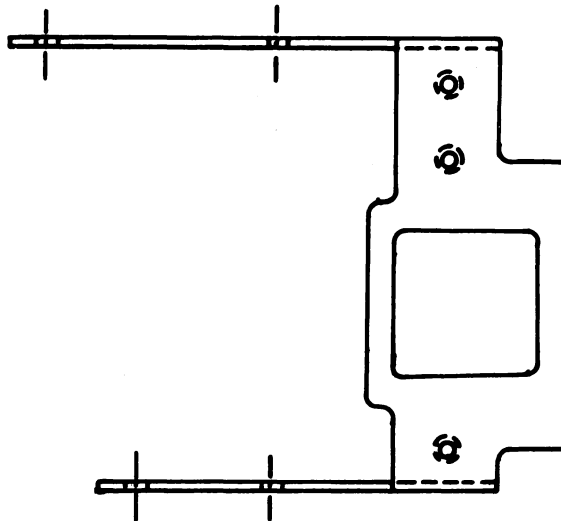

NEW TP186628 UPPER BRACKET