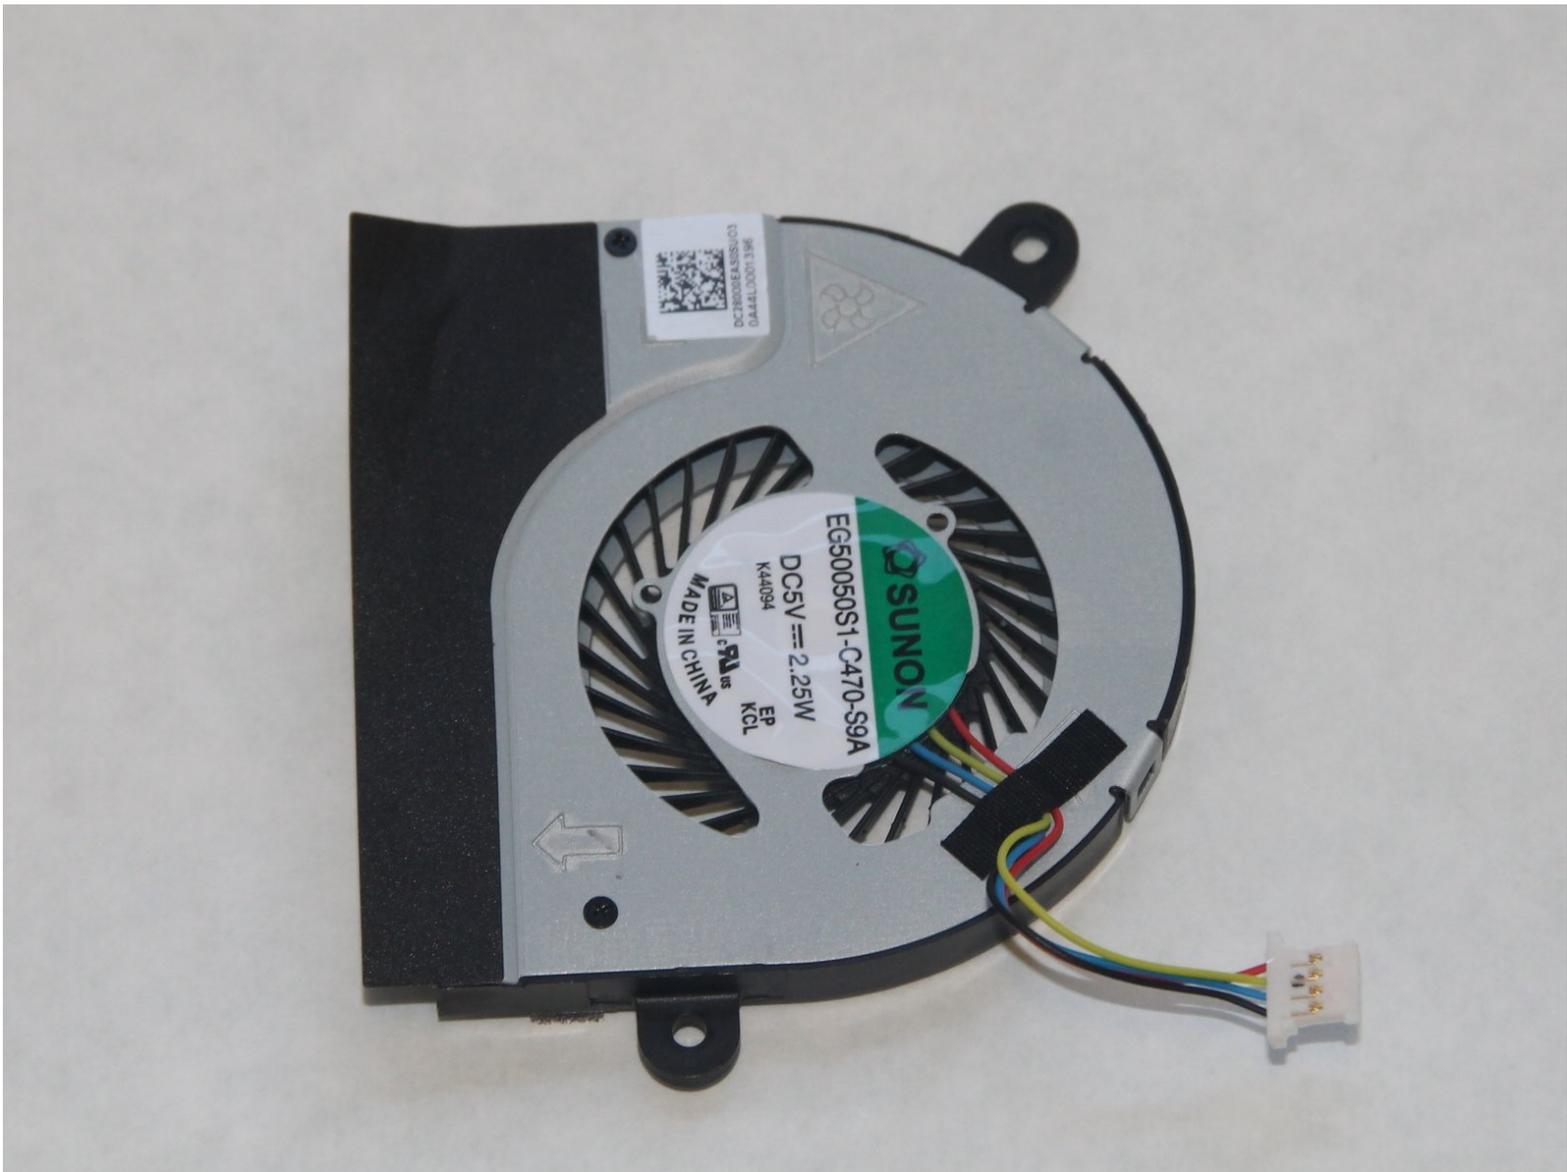# HP Pavilion 11 x360 Fan Replacement

Fix overheating issues by replacing your fan.

Written By: Natalie
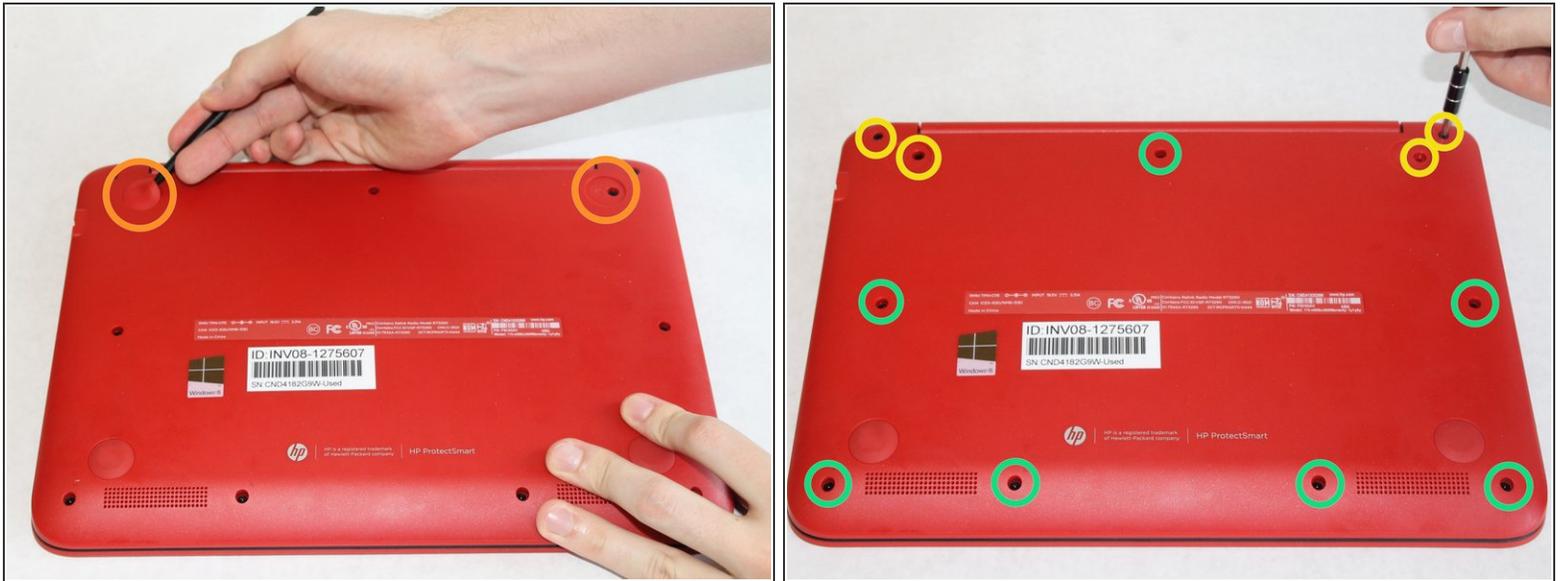
INTRODUCTION

Unplug your device from any power source and turn off your laptop before beginning.

🔧 TOOLS:

- Phillips #0 Screwdriver (1)
- iFixit Opening Tools (1)
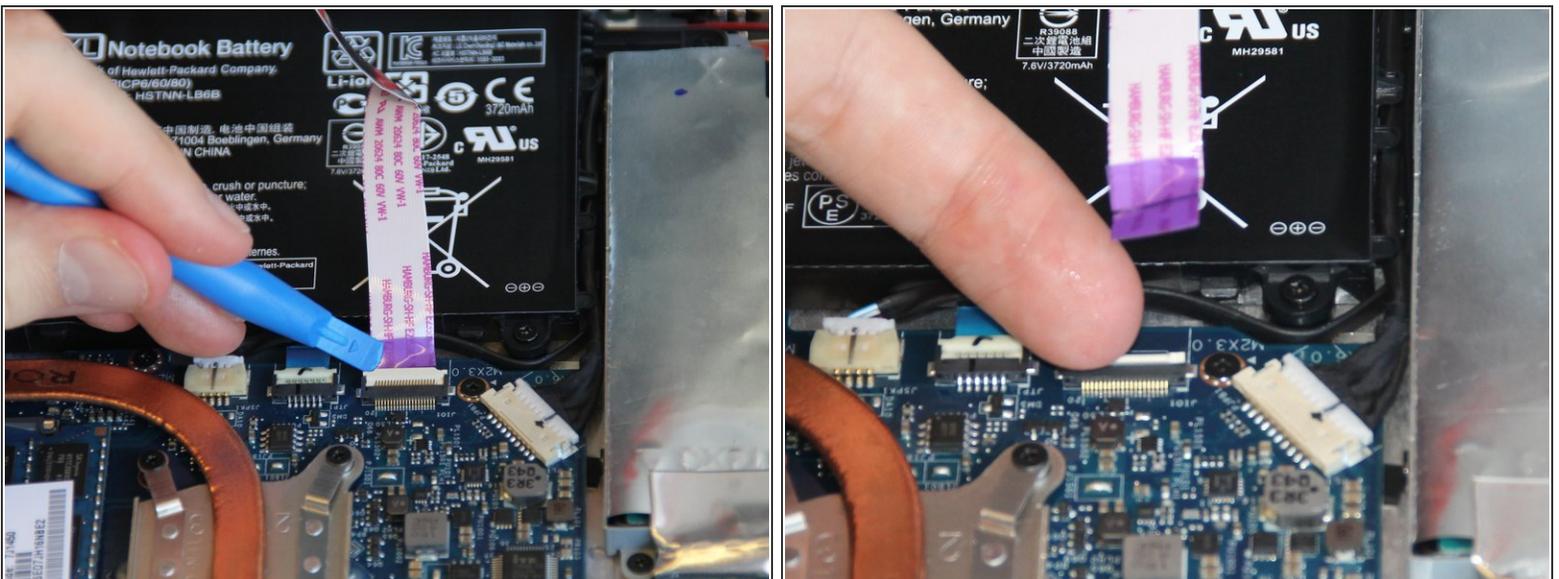- Spudger (1)

Step 1 — Remove Screws

- Use the spudger to pry off the two rubber feet near the hinge of the laptop. This will reveal two hidden 9mm screws.

- You must remove eleven screws.
  - Four 9mm screws with the PH0 screwdriver.
  - Seven 6mm screws with the PH0 screwdriver.

This document was generated on 2019-09-23 10:13:40 AM (MST).

© iFixit — CC BY-NC-SA   www.iFixit.com   Page 3 of 6
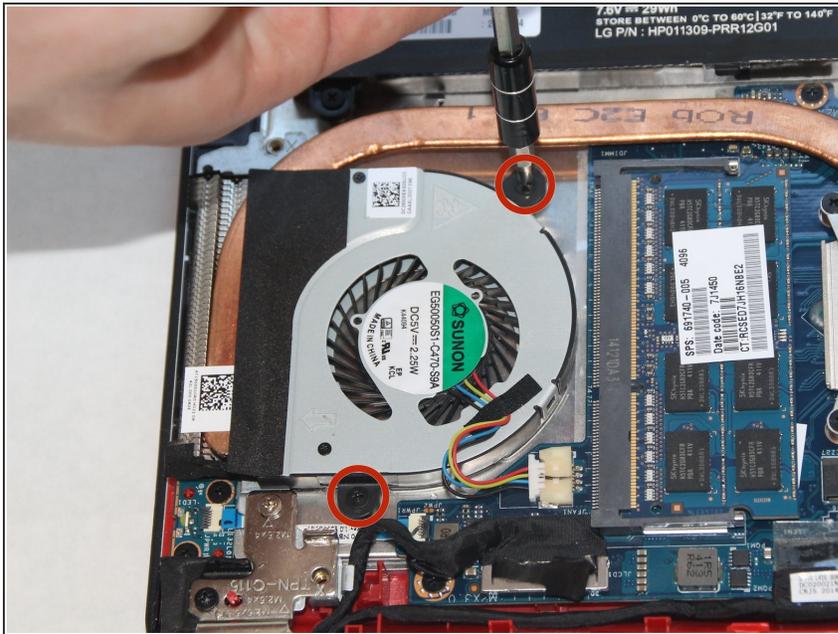
Step 2 — Remove Backing

- Use the spudger to pry the corners of the laptop near the display hinges.

- Pry around the seam of the laptop with the plastic opening tool until the backing begins to pull apart.

⚠ When you lift the bottom cover, there is a cable connected between the motherboard and the bottom cover. Be careful not to pull the cable loose!
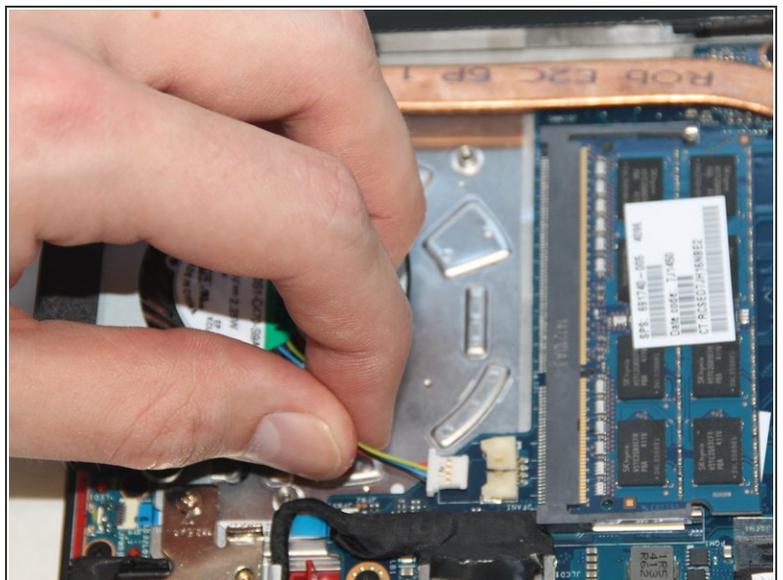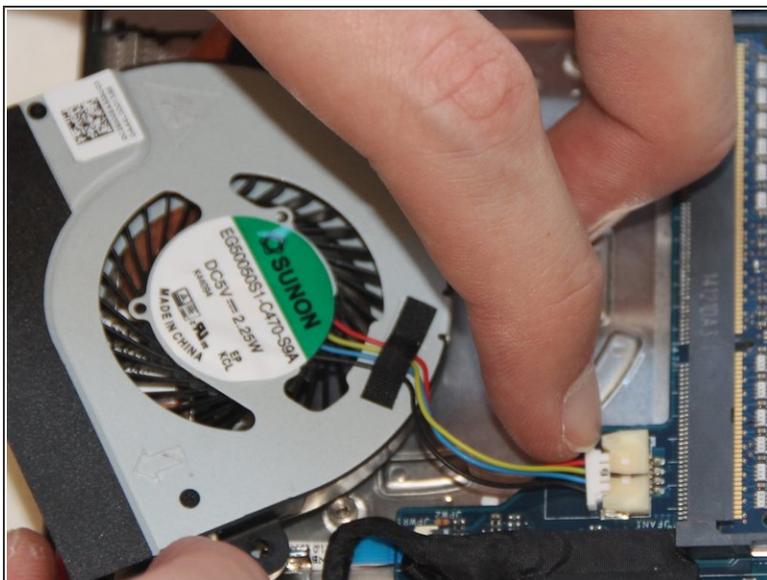
Step 3 — Detach Cable

- Use the plastic opening tool to lift the white tab up at the connection.

- Pull the cable outwards.

This document was generated on 2019-09-23 10:13:40 AM (MST).

Step 4 — Remove Screws

- Remove the two 3mm screws with the PH0 screwdriver.

Step 5 — Disconnect Cable

- Use your fingernails to slowly loosen the fan connection cable.

- After the cable is slightly pulled from the connection, grab the cable and pull it outwards.

This document was generated on 2019-09-23 10:13:40 AM (MST).

To reassemble your device, follow these instructions in reverse order.

This document was generated on 2019-09-23 10:13:40 AM (MST).