












BELL SYSTEM PRACTICES
 TELETYPEWRITER STATIONS

- NOTES:
- BROKEN LINES T2 INDICATE LEADS CARRIED THROUGH CORRESPONDINGLY NUMBERED CONTACTS OF PLUG AND SOCKET CONNECTORS. T INDICATES TYPING UNIT CONNECTOR; K, KEYBOARD.
 - INDICATES CONNECTIONS TO BE ADDED OR CHECKED FOR THEIR EXISTENCE, UNLESS OTHERWISE SPECIFIED ALL SUCH LEADS SHALL BE 22 GAUGE, BROWN, TYPE GS STATION WIRE PER AT&T SPEC. 7089.
 - INDICATES UNIT WIRING TO BE CONNECTED AS SHOWN.
 - THE 128B2 TTY SUBSCRIBER SET AND THE KS5663, L7 RECTIFIER SHALL BE MOUNTED IN THE 28 TTY CABINET.
 - THE 128B2 TTY SUBSCRIBER SET SHALL BE STRAPPED AND ADJUSTED FOR LINE AND LOOP CONDITIONS IN ACCORDANCE WITH BSP INSTRUCTIONS IN THE "P" SERIES. PROVIDE FIG. C OR D, FIG. E OR F, FIG. G OR H, AND FIG. J OR K AS REQ.
 - SOME 128B2 SUBSCRIBER SETS DO NOT INCLUDE THE (AT) RESISTANCE AND A CHECK SHOULD BE MADE TO INSURE THAT THE (AT) RESISTANCE IS PRESENT.
 - WHEN TWO OR MORE TELETYPEWRITERS INCLUDING A SPARE MACHINE ARE TO BE OPERATED FROM THE SAME 128B2 TTY SUBSCRIBER SET THROUGH THE 63CI LOOP SWITCHBOARD, THE M2DG CORD SHOWN CONNECTED TO TERMS. C39 AND C40 SHOULD BE CONNECTED TO TERMS. C39 AND C40.
 - THE FOLLOWING EQUIPMENT IS REQUIRED:

28B TTY CABINET
28B ELECTRICAL SERVICE ASSEMBLY
28A TYPING UNIT
28C TTY BASE
28A MOTOR UNIT
128B2 TTY SUBSCRIBER SET
KS-5663, L7 RECTIFIER

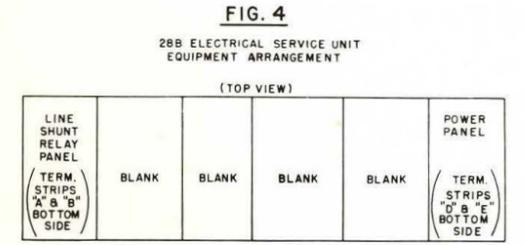

28 TYPE TELETYPEWRITER
 IN 28B TTY CABINET
 PRIVATE LINE SERVICE
 128B2 TTY SUBSCRIBER SET
 SEND AND REC, SINGLE LOOP, MAG OPERATION
 SWITCH CONTROL, 120V AC POWER

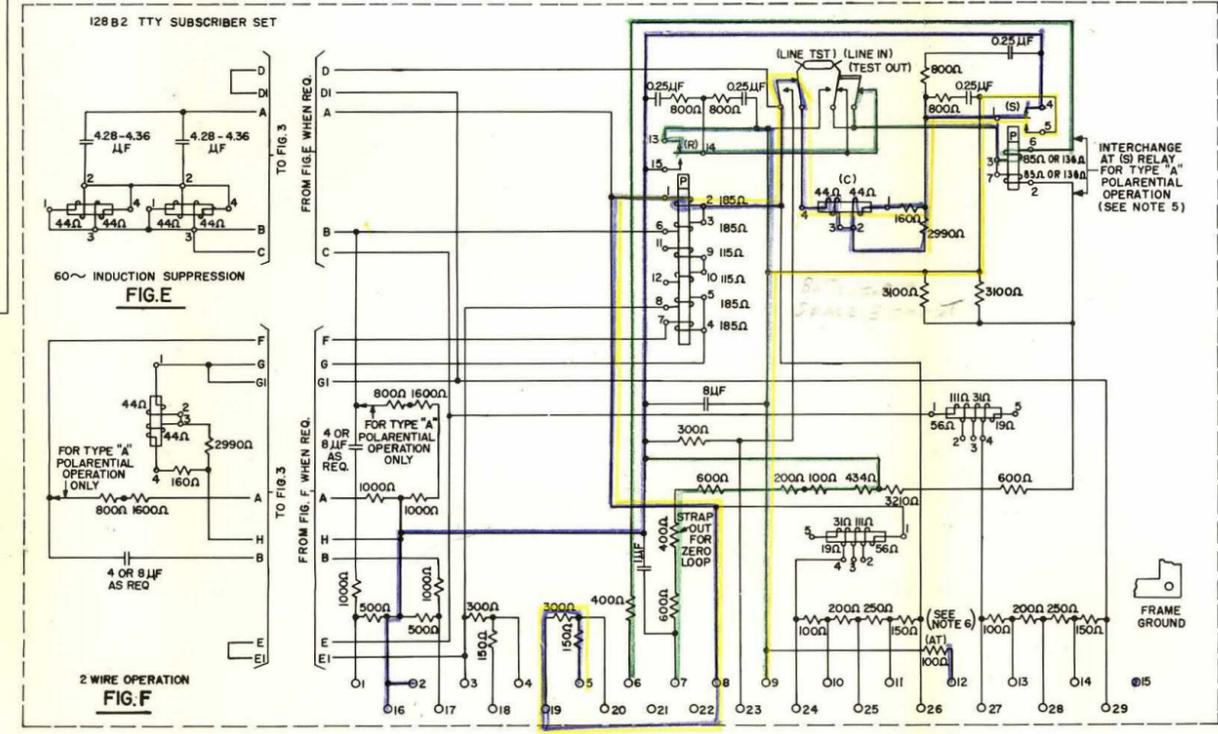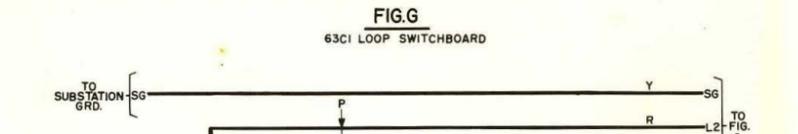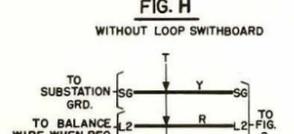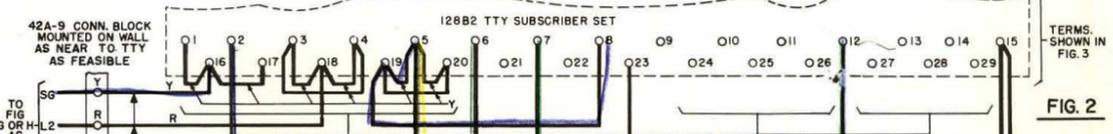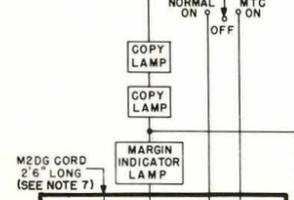

LINE
 PRINT MAG
 ARBD
 SPACE BATTERY